



NUMBER: 08-024-07

GROUP: Electrical

DATE: October 10, 2007

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of Chrysler LLC.

SUBJECT:

Distorted Sound In Door Speaker, Rear Quarter Speaker Or Rear Shelf Speaker With The Radio On

OVERVIEW:

This bulletin involves replacing **all** 6x9" base (non-premium sound system) speakers in the vehicle.

MODELS:

2007 - 2008	(LE)	300, Touring (International Markets)
2007 - 2008	(LX)	300, Charger, Magnum
2007	(L2)	300 (China)
2007- 2008	(JS)	Avenger/Sebring/Sebring Convertible
2007 - 2008	(MK)	Compass/Patriot
2007 - 2008	(PM)	Caliber
2007 - 2008	(WK)	Grand Cherokee
2007 - 2008	(WH)	Grand Cherokee (International Markets)
2007 - 2008	(XK)	Commander
2007 - 2008	(XH)	Commander (International markets)
2007 - 2008	(DR)	Ram truck
2007 - 2008	(DH/D1/DC)	Ram Truck (2500 & 3500)
2008	(RT)	Caravan/Town & Country

NOTE: This bulletin applies to vehicles built between February 26, 2007 (MDH 0226XX) and September 4, 2007 (MDH 0904XX) and sales code RCB, RCG or RCD

SYMPTOM/CONDITION:

Some customers may experience a "distorted sound" in one or more 6x9" (non-premium sound system) speakers with the radio on.

DIAGNOSIS:

If the Symptom/Condition is present, perform the Repair Procedure.



PARTS REQUIRED:

Qty.	Part No.	Description
AR	05064035AB	6x9 Speaker
AR	05091019AB	6x9 Speaker
AR	56040860AB	6x9 Speaker

REPAIR PROCEDURE:

1. Replace all the 6x9 speakers in the vehicle following the procedures available in DealerCONNECT > TechCONNECT > 8 - Electrical > Radio > Speaker > Removal and Installation. Refer to table below for 6x9 speaker quantities and location details.

Model	Radio Sales Code	Part No.	6x9 Vehicle Speaker Qty.	Speaker Location
LX	RCD or RCG	05064035AB	2	Front Doors
		05091019AB	2	Rear Shelf
PM	RCD	05091019AB	4	All 4 Doors
MK	RCD	05091019AB	4	All 4 Doors
JS-41	RCD or RCG	05091019AB	4	Front Doors and Rear Shelf
JS-27	RCD or RCG	05091019AB	2	Front Doors
WK	RCG	05091019AB	2	Front Doors
XK	RCG	05091019AB	2	Front Doors
DR	RCD	56040860AB	2	Front Doors
DH	RCD	56040860AB	2	Front Doors
DC	RCD	56040860AB	2	Front Doors
D1	RCD	56040860AB	2	Front Doors
RT	RCD or RCG	05091019AB	4	Front Doors and Rear Quarter Trim
	RCB	05091019AB	2	Front Doors

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Amount
08-60-70-95	Speaker, Sound System - Replace Two Speakers (B)	DR/DH/DC/D1 0.5 Hrs. RT/XK/XH /WK/WH 0.5 Hrs. JS-27 0.4 Hrs.
08-60-70-96	Speaker, Sound System - Replace Four Speakers (B)	LX/LE 1.2 Hrs PM/MK 0.5 Hrs. RT/JS-41 0.9 Hrs.

FAILURE CODE:

ZZ	Service Action
----	----------------