

NUMBER: 24-001-10

GROUP: Heating & Air

Conditioning

DATE: January 12, 2010

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of Chrysler Group LLC.

SUBJECT:

Rear Defroster Switch Engagement Effort

OVERVIEW:

This bulletin involves remove the ATC control head and insert two screws (p/n 68078941AA) into the back per the repair procedure.

MODELS:

2010	(LX)	300/300C/Charger
2010	(LE)	300C/300C Touring (International Markets)
2010	(WK)	Grand Cherokee
2010	(XK)	Commander
2010	(XH)	Commander (International Markets)

NOTE: The bulletin applied to vehicles equipped with Air Conditioning (Sales Code HAA or HAF) built before August XX, 2009 (MDH XXXXXX).

SYMPTOM/CONDITION:

Customer may experience a rear defroster switch that has higher than desired engagement effort. This condition is caused by the ATC housing having too much deflection when the button is pressed which does not close the switch properly. Extra push effort will close the switch.

DIAGNOSIS:

If the above symptom/condition is experienced perform the Repair Procedure.

PARTS REQUIRED:

Qty.	Part No.	Description
2	68078941AA	Screw



24-001-10 -2-

REPAIR PROCEDURE:

- Remove the ATC Control head. Follow the detailed service procedures available in DealerCONNECT/TechCONNECT, Refer To Group 24 - Heating & Air Conditioning > Controls > Controls, A/C and Heater Removal procedures.
- 2. Install the two screws into the back of the ATC control head p/n 68078941AA (Fig. 1).

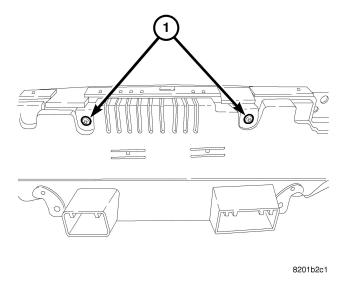


Fig. 1 ATC HEAD SCREW LOCATIONS

1 -Screw Location

 Install ATC Control head. Follow the detailed service procedures available in DealerCONNECT/TechCONNECT, Refer To Group 24 - Heating & Air Conditioning > Controls > Controls, A/C and Heater Installation procedures.

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Amount
24-75-01-90	Install Screws in ATC Control Head (B)	0.2 Hrs.

FAILURE CODE:

ZZ	Service Action
----	----------------