

**NUMBER:** 18-038-07

**GROUP:** Vehicle Performance

**DATE:** June 9, 2007

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of DaimlerChrysler Corporation.

# THE StarSCAN® FLASH FILES FOR THIS BULLETIN MUST BE RETRIEVED FROM THE INTERNET.

# StarSCAN® SOFTWARE LEVEL MUST BE AT RELEASE 7.04\_SP1 OR HIGHER FOR THIS BULLETIN.

## SUBJECT:

FLASH: 6.1L - SRT8 - Charging System Voltage

## **OVERVIEW:**

This bulletin involves selectively erasing and reprogramming the Powertrain Control Module (PCM).

### **MODELS:**

2007	(WK)	Grand Cherokee
2007	(WH)	Grand Cherokee — International markets
2007	(LX)	Charger, 300, Magnum
2007	(LE)	Charger, 300 — International Markets

### SYMPTOM/CONDITION:

The vehicle operator may experience any of the following symptoms:

Front Door Control Module (FDCM) Dropout (WK/WH only)

Radio Dropout

All Wheel Drive Will Not Engage

You may also encounter one of more of the following Diagnostic Trouble Codes (DTC's) when diagnosing Electronic Control modules:

B210D - Battery Voltage Low B210E - Battery Voltage High

## **DIAGNOSIS:**

Using a Scan Tool (StarSCAN®) with the appropriate Diagnostic Procedures available in TechCONNECT, verify all engine systems are functioning as designed. If DTC's are present record them on the repair order and repair as necessary before proceeding further with this bulletin.

### PARTS REQUIRED:



Qty.	Part No.	Description
1	04275086AB	Label, Authorized Modification

## SPECIAL TOOLS / EQUIPMENT REQUIRED:

NPN	Battery Charger	
CH9401	StarSCAN® Tool	
CH9404	StarSCAN® Vehicle Cable	
CH9409	StarSCAN® Documentation Kit	
CH9410	StarSCAN® Ethernet Cable, 12 ft.	
CH9412	2 StarSCAN® Software Update Device Kit	
	TechCONNECT PC or equivalent	

### REPAIR PROCEDURE - USING THE INTERNET TO RETRIEVE THE FLASH FILE:

NOTE: When performing this Repair Procedure, the software release level in the StarSCAN®; must be programmed with 7.04\_ SP1 software or higher. The software release level is visible in the blue header at the top of the StarSCAN® screen.

NOTE: The StarSCAN® diagnostic scan tool fully supports Internet connectivity. However, to take advantage of this feature you must first configure the StarSCAN® for your dealership's network. Make sure the StarSCAN® is configured to the dealership's network before proceeding. For instruction on setting up your StarSCAN® for the dealer's network refer to either: "DealerCONNECT > Service > StarSCAN and StarMOBILE tools > Online Documentation", or refer to the StarSCAN® Quick Start Networking Guide. The StarSCAN® Quick Start Networking Guide is also available on the www.dcctools.com website under the "Download Center".

## NOTE: If this flash process is interrupted/aborted, the flash should be restarted.

- Install a battery charger and verify that the charging rate provides approximately 13.5 volts. Set the battery charger to continuous charge. Do not allow the charger to time out during the flash process. Remove the charger from the battery when the flash process is complete.
- 2. Connect the CH9410 StarSCAN® ethernet cable to the StarSCAN® and the dealer's network drop.
- 3. Connect the CH9404 StarSCAN® vehicle cable to the StarSCAN® and the vehicle.
- 4. Power ON the StarSCAN®.
- 5. Using the StarSCAN® at the "Home" screen:
  - a. Select "ECU View"
  - b. Touch the screen to highlight the PCM in the list of modules.
  - c. Select "More Options"
  - d. Select "ECU Flash"
  - e. Record the part number at the top of the "Flash PCM" screen for later reference.
  - f. Select "Browse for New File". Follow the on screen instructions.

-3- 18-038-07

- g. Select "Download to Scantool".
- h. Select "Close" after the download is complete, then select "Back".
- i. Highlight the listed calibration.
- j. Select "Update Controller". Follow on screen instructions.
- k. When the update is complete, select "OK".
- I. Verify the part number at the top of the "Flash PCM" screen has updated to the new part number.

# NOTE: The following step is required by law when reprogramming a PCM and/or TCM.

6. Type the necessary information on the "Authorized Modification Label" p/n 04275086AB and attach near the VECI label (Fig. 1).

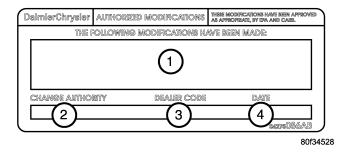


Fig. 1 AUTHORIZED MODIFICATION LABEL

- 1 POWERTRAIN CONTROL / TRANSMISSION CONTROL MODULE P/N's (INSERT P/N's) USED
- 2 CHANGE AUTHORITY: TSB XX-XXX-XX
- 3 DEALER CODE: XXXXX
- 4 DATE: XX-XX-XX

### **POLICY:**

Reimbursable within the provisions of the warranty.

## TIME ALLOWANCE:

Labor Operation No:	Description	Amount
18-19-06-93	Module, Powertrain Control (PCM) - Reprogram (B)	0.4 Hrs.

#### FAILURE CODE:

ZZ Service Action	
-------------------	--